

4 4 0 6 3 5 2 0 0 0  
T. R. Sec. Row Col.

260612

REGISTER'S OFFICE  
Bayfield County, Wis. } S.S.

R9-5680-5 (7/15/64) H. C. MILLER CO., MILWAUKEE 448643

RECORDED AT 1:50 P.M.

CERTIFIED LAND CORNER RESTORATION

ON APR 23 1968 IN  
Vol. 1 of 517 Page 243

Earl Pedersen  
REGISTER OF DEEDS

State of Wisconsin }  
County of Bayfield } ss.

I, Elwood L. Olson, do hereby certify that on the 20th day of June, 1967, I found evidence of the Quarter corner of Sections 35 and 36 Township 44 North, Range 6 West, Fourth Principal Meridian, as described hereon; and that from this evidence I established a new monument and accessories as described hereon to perpetuate the original location of this corner:

Description of original monument and accessories and subsequent restorations:

Original corner established in 1858 by Daniel E. Norton, Government Deputy Surveyor. Hemlock 16 N83W 15 links. " 20 N24E 15 "

From field notes of Jerod W. Day, Surveyor, dated June 18, 1916: 2606.5 ft.: Set hub and defl. 81°30' to W. and run 215.5 ft. to 1/4 corner bet. secs. 35 and 36 where I find stumps of both original bearing trees. Set cedar stake at corner.

From 874-9 corner form by Robt. Rykert, U.S. Forest Service, dated 7-12-1936: Corner marked by wood stake. Original bearing tree, Hemlock 16", S70°W, 9 feet. Hemlock 13", S55°W, 15 links. Location poster.

Description of corner evidence found:

Corner marked by old squared wood stake alongside of which I found a very old squared stake laying under moss. From corner the decayed stump of the original Hemlock bearing tree with old inscription "1/4S" visible brs. S70°W, 15 links. Decayed stump of other original Hemlock bearing tree brs. N24°E, 15 links. Found Rykert's location poster on 17" dia. Hemlock brng. S49°W, 11.8 feet from corner. (Nailed new location poster on this tree) The corner is on the west edge of a small swamp.

Description of monument and accessories I established to perpetuate the original location of this corner:

To mark the original location of this corner I set a 2" inside dia., 5' long, flanged bottom, concrete filled, galvanized wrought iron pipe, extending 12" above ground, with 3" bronze tablet stamped: ORIGINAL CORNER LOCATION, T44NR6W, 1/4, S35, S36, R.L.S.785, 1967. Blazed and scribed new bearing trees as follows:  
White Pine 13" N36°E, 45.1 feet.  
Cedar 10" S19°E, 6.3 feet.  
Cedar 13" S20°W, 40.4 feet.  
Iron sign post, North, 3.1 feet.  
Metal BT sign on all bearing trees.



Resident witnesses.....

Dated at Park Falls Wisconsin, this 24th day of January 19 68.


Signature Elwood L. Olson Title Registered Land Surveyor  
(County Surveyor, Registered Land Surveyor, or other duly authorized official)

Surveyors Registration No. S-785

Office of..... County of.....

I hereby certify that the within instrument was filed in this office for record on the.....day of.....19....., and was filed in Book No.....Page No.....of County Records.

Signature..... Title.....

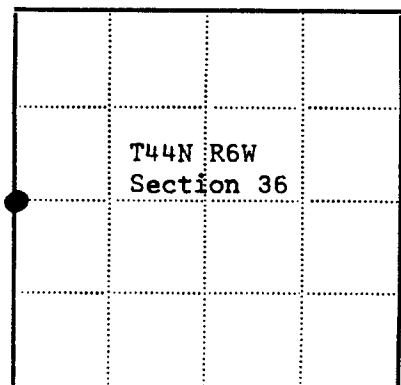

● = Corner monument restored

□ =

# Bayfield County Land Records Department

THIS IS NOT A CERTIFIED LAND CORNER RESTORATION DOCUMENT

WI ID #	4406352000
Section	35
Town	44
Range	6
PLSS location	E 1/4 35
Monument Found	3" CAP
Condition of Monument	Undisturbed
Date of field work	10/17/01
Northing	333795
Easting	770667
Latitude	46.24852828
Longitude	-91.07109311
Date recorded	1858
Set by	D. NORTON
Date of perpetuation	6/22/1967
Perpetuated by	E. OLSON
Comment	
Rate of Coordinates	GPS sub-meter
Picture #1	0123.JPG
Picture #2	N/A

Photo of Monument



**DISCLAIMER NOTE:** This project involved a reconnaissance recovery of suspected PLSS corners – it is not to be construed as comprehensive retracement and recovery. This may or may not be the correct location of said PLSS corner. This location can only be used for a PLSS Inventory Assessment.