

CERTIFIED LAND CORNER RESTORATION

Index No. 9

174

History of original corner establishment:  
Original corner established in 1857 by Albert C. Stuntz, Government Deputy Surveyor.

Tamarac 7 N48E 12 links.  
Tamarac 4 S37W 27 links.

Description of corner evidence found:

Corner marked by old squared cedar post from which:  
Original Tamarac bearing tree fallen and under moss, overgrowth and scribe marks BT visible, bears N48°E, 12 links.  
Decayed stump and windfall of original Tamarac bearing tree, 18" dia., bears S35°W, 29 links.  
The corner is in a swamp.

Description of monument and accessories I established to perpetuate the original location of this corner.

Set 2" inside dia., 5' long, flanged bottom, concrete filled, galvanized wrought iron pipe with 3" bronze tablet stamped: ORIGINAL CORNER LOCATION, T4N, R5W, 4, S1, S36, T43N, R5W, S.785, 1964. Monument set 7" above swamp level. Set red top cedar post 3.5 ft. S. of monument. Blazed and scribed new bearing trees as follows:  
Cedar 8" S12°E, 17.6 feet.  
Cedar 10" N42°30'E, 6.7 feet.  
Cedar 6" S72°W, 19.8 feet.  
Paint bearing trees red. Nail metal BT sign on bearing trees.

Dated at Park Falls, Wis., this 19th day of June, 1964.

Signature Edward A. Clark Title Registered Land Surveyor Registration No. S.785  
(County Surveyor, Registered Land Surveyor, or other duly authorized official)

Office of Register of Deeds, County of \_\_\_\_\_, I hereby certify that the within instrument was filed in this office for record on the \_\_\_\_\_ day of \_\_\_\_\_, 19\_\_\_\_ at \_\_\_\_\_ o'clock \_\_\_\_\_ M.

(Register of Deeds)

By \_\_\_\_\_ Deputy

CORNER NUMBER


T. 4 4 R. 5 Sec. 3 6 Row 0 0 Col. 0 0

FORM 985 H. C. MILLER CO., MI.

State of Wisconsin }  
County of Bayfield } ss.

I Elwood L. Olson, do hereby certify that on the 13th day of May 1964, I found evidence of the One Quarter corner of Sections 1 and 36 Township 43 and 44, North, Range 5 West, Fourth Principal Meridian, as described hereon; and that from this evidence I established a new monument and accessories as described hereon to perpetuate the original location of this corner.  
Resident witnesses:

244964  
REGISTER'S OFFICE  
Bayfield County, Wis.  
RECORDED AT 11:50 A.M.  
ON MAR 31 1965 IN  
Vol. 1 of 500 Page 174  
Earl Pederson  
REGISTER OF DEEDS

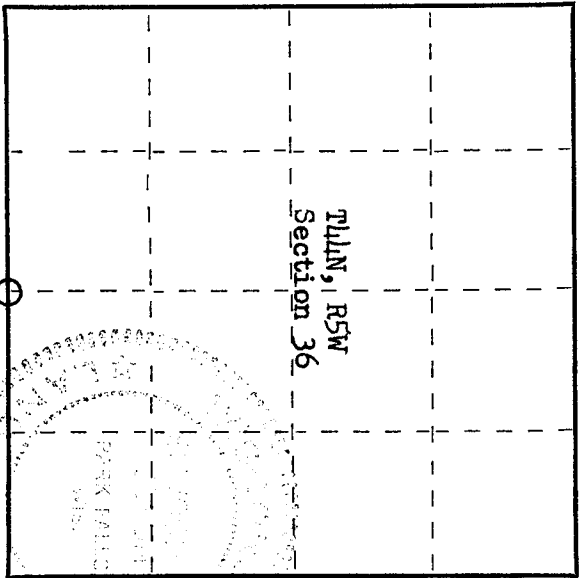

○ = Corner monument restored.